Turbocharger (TC) wastegate regulating valve

Component disconnected

Fig. 25024

Terminals	Condition	Typical value	Note
1 & earth	Ignition ON	11-14 V	1, 2

Notes


- 1. Checking supply voltage.
- 2. Engine control (EC) relay must be fitted and working correctly in order to carry out supply voltage checks.

Turbocharger (TC) wastegate regulating valve

Component disconnected

Fig. 20406

Terminals	Condition	Typical value	Note
1 & 2		14-20 Ω	

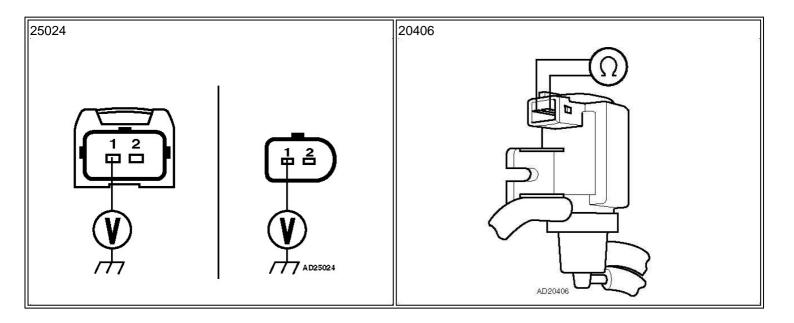

 Manufacturer:
 Volkswagen
 Model:
 Golf (98-06) 1,9D TDI PD
 © Autodata Limited 2007

 Engine code:
 ASZ
 Output:
 96 (131) 4000
 16.8.2009 г.

 Tuned for:
 Year:
 2000-05
 V6 410 // Autodata